



Model: SAMSUNG MZ7LM1T9

S/N: S2TVNX0J104882

Disk Erasure Report

Page 1 - Erasure Status



Organisation Performing The Disk Erasure

Business Name: **GridJet**

Business Address:

Contact Name: **GDW-LDS-6**

Contact Phone:

Customer Details

Name: **Gridjet**

Address:

Contact Name:

Contact Phone:

Disk Information

Make/Model: **SAMSUNG MZ7LM1T9**

Serial: **S2TVNX0J104882**

Size(Apparent): **1920 GB, 1920383410176 bytes**

Bus: **ATA-SSD**

Size(Real): **1920 GB, 1920383410176 bytes**

Disk Erasure Details

Start time: **2025/02/12 14:34:52**

End time: **2025/02/12 22:42:35**

Duration: **08:07:43**

Status: **ERASED**

Method: **PRNG Stream**

PRNG algorithm: **XORshiro256**

Final Pass(Zeros/Ones/None): **Zeros**

Verify Pass(Last/All/None): **Verify Last**

*Bytes Erased: **1920383410176, (100.00%)**

Rounds(completed/requested): **1/1**

HPA/DCO: **No hidden sectors**

HPA/DCO Size: **No hidden sectors**

Errors(pass/sync/verify): **0/0/0**

Throughput: **196 MB/sec**

Information:

* bytes erased: The amount of drive that's been erased at least once

Technician/Operator ID

Signature:

Name/ID: **Auto Wipe**



Model: SAMSUNG MZ7LM1T9

S/N: S2TVNX0J104882

Disk Erasure Report

Page 2 - Smart Data



smartctl 7.2 2020-12-30 r5155 [x86_64-linux-5.14.0-503.23.1.el9_5.x86_64] (local build)
copyright (c) 2002-20, bruce allen, christian franke, www.smartmontools.org

=== start of information section ===

model family: Samsung based SSDs
device model: SAMSUNG MZ7LM1T9HJMP-00005
serial number: S2TVNX0J104882
lu wwn device id: 5 002538 c404ed2f5
firmware version: GXT5104Q
user capacity: 1,920,383,410,176 bytes [1.92 TB]
sector size: 512 bytes logical/physical
rotation rate: Solid State Device
form factor: 2.5 inches
trim command: Available, deterministic, zeroed
device is: In smartctl database [for details use: -P show]
ata version is: ACS-2, ATA8-ACS T13/1699-D revision 4c
sata version is: SATA 3.1, 6.0 Gb/s (current: 6.0 Gb/s)
local time is: Wed Feb 12 22:42:36 2025 GMT
smart support is: Available - device has SMART capability.
smart support is: Enabled

=== start of read smart data section ===

smart overall-health self-assessment test result: PASSED

general smart values:

offline data collection status: (0x02)Offline data collection activity
was completed without error.
auto offline data collection: Disabled.
self-test execution status: (0)The previous self-test routine completed
without error or no self-test has ever
been run.
total time to complete offline
data collection: (6000) seconds.
offline data collection
capabilities: (0x53) SMART execute Offline immediate.
auto offline data collection on/off support.
suspend offline collection upon new
command.
no offline surface scan supported.
self-test supported.
no conveyance self-test supported.
selective self-test supported.
smart capabilities: (0x0003)Saves SMART data before entering
power-saving mode.
supports smart auto save timer.
error logging capability: (0x01)Error logging supported.
general purpose logging supported.
short self-test routine
recommended polling time: (2) minutes.
extended self-test routine
recommended polling time: (100) minutes.
sct capabilities: (0x003d)SCT Status supported.
sct error recovery control supported.
sct feature control supported.
sct data table supported.

smart attributes data structure revision number: 1

vendor specific smart attributes with thresholds:

id#	attribute_name	flag	value	worst	thresh	type	updated	when_failed	raw_value
5	reallocated_sector_ct	0x0033	045	045	010	pre-fail	always	-	3578
9	power_on_hours	0x0032	090	090	000	old_age	always	-	46366
12	power_cycle_count	0x0032	099	099	000	old_age	always	-	44
177	wear_leveling_count	0x0013	082	082	005	pre-fail	always	-	1288
179	used_rsvid_blk_cnt_tot	0x0013	045	045	010	pre-fail	always	-	3578



Model: SAMSUNG MZ7LM1T9

S/N: S2TVNX0J104882

Disk Erasure Report

Page 3 - Smart Data



180	unused_rsvd_blk_cnt_tot	0x0013	045	045	010	pre-fail	always	-	2938
181	program_fail_cnt_total	0x0032	100	100	010	old_age	always	-	0
182	erase_fail_count_total	0x0032	100	100	010	old_age	always	-	0
183	runtime_bad_block	0x0013	045	045	010	pre-fail	always	-	3578
184	end-to-end_error	0x0033	100	100	097	pre-fail	always	-	0
187	uncorrectable_error_cnt	0x0032	099	099	000	old_age	always	-	8412
190	airflow_temperature_cel	0x0032	060	054	000	old_age	always	-	40
194	temperature_celsius	0x0022	060	054	000	old_age	always	-	40 (min/max 10/46)
195	ecc_error_rate	0x001a	199	199	000	old_age	always	-	8412
197	current_pending_sector	0x0032	100	100	000	old_age	always	-	0
199	crc_error_count	0x003e	100	100	000	old_age	always	-	0
202	exception_mode_status	0x0033	100	100	010	pre-fail	always	-	0
235	por_recovery_count	0x0012	099	099	000	old_age	always	-	39
241	total_lbas_written	0x0032	098	098	000	old_age	always	-	3012953340655
242	total_lbas_read	0x0032	099	099	000	old_age	always	-	523971176964
243	sata_downshift_ct	0x0032	100	100	000	old_age	always	-	0
244	thermal_throttle_st	0x0032	100	100	000	old_age	always	-	0
245	timed_workld_media_wear	0x0032	100	100	000	old_age	always	-	65535
246	timed_workld_rdw_ratio	0x0032	100	100	000	old_age	always	-	65535
247	timed_workld_timer	0x0032	100	100	000	old_age	always	-	65535
251	nand_writes	0x0032	100	100	000	old_age	always	-	5540417336704

smart error log version: 1

ata error count: 8412 (device log contains only the most recent five errors)

cr = command register [hex]

fr = features register [hex]

sc = sector count register [hex]

sn = sector number register [hex]

cl = cylinder low register [hex]

ch = cylinder high register [hex]

dh = device/head register [hex]

dc = device command register [hex]

er = error register [hex]

st = status register [hex]

powered_up_time is measured from power on, and printed as

ddd+hh:mm:ss.sss where DD=days, hh=hours, mm=minutes,

ss=sec, and sss=millisec. it "wraps" after 49.710 days.

error 8412 occurred at disk power-on lifetime: 43786 hours (1824 days + 10 hours)
when the command that caused the error occurred, the device was active or idle.

after command completion occurred, registers were:

er st sc sn cl ch dh

-- -- -- -- --

00 51 00 a7 39 b3 40 error: at LBA = 0x00b339a7 = 11745703

commands leading to the command that caused the error were:

cr	fr	sc	sn	cl	ch	dh	dc	powered_up_time	command/feature_name
----	----	----	----	----	----	----	----	-----------------	----------------------

-- -- -- -- --

61	38	00	38	e7	ed	40	00	00:23:52.378	WRITE FPDMA QUEUED
----	----	----	----	----	----	----	----	--------------	--------------------

61	08	00	68	03	d8	40	00	00:23:52.378	WRITE FPDMA QUEUED
----	----	----	----	----	----	----	----	--------------	--------------------

61	08	00	d0	57	41	40	00	00:23:52.378	WRITE FPDMA QUEUED
----	----	----	----	----	----	----	----	--------------	--------------------

61	18	00	58	13	04	40	00	00:23:52.378	WRITE FPDMA QUEUED
----	----	----	----	----	----	----	----	--------------	--------------------

61	10	08	c8	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED
----	----	----	----	----	----	----	----	--------------	--------------------

error 8411 occurred at disk power-on lifetime: 43786 hours (1824 days + 10 hours)
when the command that caused the error occurred, the device was active or idle.


after command completion occurred, registers were:

er st sc sn cl ch dh

-- -- -- -- --

00 51 00 a6 39 b3 40 error: at LBA = 0x00b339a6 = 11745702

commands leading to the command that caused the error were:



Model: SAMSUNG MZ7LM1T9

S/N: S2TVNX0J104882

Disk Erasure Report

Page 4 - Smart Data



cr	fr	sc	sn	cl	ch	dh	dc	powered_up_time	command/feature_name
61	18	00	58	13	04	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	10	08	c8	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED
61	08	00	b8	e3	71	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	08	10	40	e3	71	40	02	00:23:52.378	WRITE FPDMA QUEUED
61	18	08	08	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED

error 8410 occurred at disk power-on lifetime: 43786 hours (1824 days + 10 hours)
when the command that caused the error occurred, the device was active or idle.

after command completion occurred, registers were:

er st sc sn cl ch dh

-- -- -- -- --

00 51 00 a5 39 b3 40 error: at LBA = 0x00b339a5 = 11745701

commands leading to the command that caused the error were:

cr	fr	sc	sn	cl	ch	dh	dc	powered_up_time	command/feature_name
61	18	00	58	13	04	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	10	08	c8	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED
61	08	00	b8	e3	71	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	08	10	40	e3	71	40	02	00:23:52.378	WRITE FPDMA QUEUED
61	18	08	08	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED

error 8409 occurred at disk power-on lifetime: 43786 hours (1824 days + 10 hours)
when the command that caused the error occurred, the device was active or idle.

after command completion occurred, registers were:

er st sc sn cl ch dh

-- -- -- -- --

00 51 00 a4 39 b3 40 error: at LBA = 0x00b339a4 = 11745700

commands leading to the command that caused the error were:

cr	fr	sc	sn	cl	ch	dh	dc	powered_up_time	command/feature_name
61	18	00	58	13	04	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	10	08	c8	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED
61	08	00	b8	e3	71	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	08	10	40	e3	71	40	02	00:23:52.378	WRITE FPDMA QUEUED
61	18	08	08	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED

error 8408 occurred at disk power-on lifetime: 43786 hours (1824 days + 10 hours)
when the command that caused the error occurred, the device was active or idle.

after command completion occurred, registers were:

er st sc sn cl ch dh

-- -- -- -- --

00 51 00 a3 39 b3 40 error: at LBA = 0x00b339a3 = 11745699


commands leading to the command that caused the error were:

cr	fr	sc	sn	cl	ch	dh	dc	powered_up_time	command/feature_name
61	18	00	58	13	04	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	10	08	c8	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED
61	08	00	b8	e3	71	40	00	00:23:52.378	WRITE FPDMA QUEUED
61	08	10	40	e3	71	40	02	00:23:52.378	WRITE FPDMA QUEUED
61	18	08	08	e3	71	40	01	00:23:52.378	WRITE FPDMA QUEUED

smart self-test log structure revision number 1

num	test_description	status	remaining	lifetime(hours)	lba_of_first_error
# 1	short offline	completed without error	00%	4039	-

smart selective self-test log data structure revision number 1

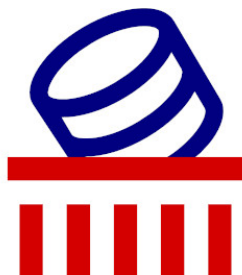

Model: SAMSUNG MZ7LM1T9

S/N: S2TVNX0J104882

Disk Erasure Report

Page 5 - Smart Data



span	min_lba	max_lba	current_test_status
1	0	0	not_testing
2	0	0	not_testing
3	0	0	not_testing
4	0	0	not_testing
5	0	0	not_testing
255	0	65535	read_scanning was completed without error

selective self-test flags (0x0):
after scanning selected spans, do not read-scan remainder of disk.
if selective self-test is pending on power-up, resume after 0 minute delay.